


The Belt Driven Spindle for Machining Centre

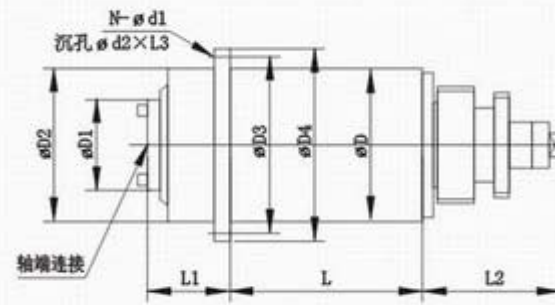

| Spindle type | Speed (r/min) | Dimensions(mm) | | | | | | | | | | Joint of spindle nose | | Bearings type | Character |
|--------------|------------------|----------------|-------|-----|-----|-----|-----|-----|-----|---------|--------|--------------------------|-----|----------------------------------|---|
| | | D | D1 | D2 | D3 | D4 | L | L1 | L2 | N-d1 | d2×L3 | | | | |
| APX1240-06 | 6000 | 120 | 78 | 130 | 146 | 165 | 170 | 128 | 90 | 6-Φ9 | Φ14×8 | BT40 taper hole | 5.5 | 4×B7011AC/P4 2×B7011AC/P5 | Belt driven type Change tool by hand |
| AP1240-06 | 6000 | 120 | 76 | 120 | 145 | 165 | 156 | 145 | 123 | 6-Φ9 | Φ15×8 | BT40 taper hole | 5.5 | 4×B7011AC/P4 2×B7011AC/P5 | Belt driven type and broaching tool |
| AP1230-10 | 10000 | 120 | 69.82 | 120 | 144 | 177 | 240 | 100 | 200 | 6-Φ11 | Φ17×11 | BT30 taper hole | 5.5 | 3×B7010C/P4 2×B7009C/P4 | Belt driven type and broaching tool |
| AP1430-08 | 8000 | 140 | 69.82 | 140 | 164 | 187 | 250 | 110 | 200 | 6-Φ11 | Φ17×11 | BT30 taper hole | 5.5 | 3×B7012C/P4 2×B7010C/P4 | Belt driven type and broaching tool |
| AP1440-06 | 6000 | 140 | 88.8 | 140 | 164 | 187 | 245 | 135 | 212 | 8-Φ11 | Φ17×11 | BT40 taper hole | 7.5 | 4×B7014C/P4 2×B7012C/P4 | Belt driven type and broaching tool |
| AP1440-08 | 8000 | 140 | 88.8 | 140 | 164 | 187 | 245 | 135 | 212 | 8-Φ11 | Φ17×11 | BT40 taper hole | 7.5 | 3×B7013C.T.P4S 3×B7011C.T.P4S | Belt driven type and broaching tool |
| AP1550-05 | 5000 | 150 | 128.6 | 160 | 170 | 190 | 280 | 75 | 190 | 8-Φ9 | Φ14×10 | BT50 taper hole | 7.5 | 4×B7015C/P4 2×B7013C/P4 | Belt driven type and broaching tool |
| AP1540-08 | 8000 | 150 | 88.88 | 160 | 180 | 200 | 200 | 137 | 232 | 8-Φ11 | Φ17×10 | BT40 taper hole | 7.5 | 4×B7014C/P4 2×B7012C/P4 | Belt driven type and broaching tool |
| AP2150-03 | 3000 | 210 | 128.6 | 210 | 230 | 250 | 398 | 62 | 158 | 8-Φ9 | - | Xt50 taper hole | 11 | 4×7021C/P4 2×7018C/P4 | Belt driven type and broaching tool |
| AP2150-03A | 3000 | 210 | 128.6 | 210 | 260 | 290 | 440 | 90 | 267 | 4-Φ17.5 | Φ26×20 | IS050 taper hole | 11 | 4×B7020C/P4 2×B7018C/P4 | Belt driven type and broaching tool |
| AP2350-01 | 1000 | 190 | 128.6 | 230 | 265 | 300 | 208 | 340 | 42 | 6-Φ18 | Φ26×16 | IS050 taper hole | 15 | 3×B7220C/P4 2×6217/P5 | Rigid type and broaching tool |
| AP1240-08 | 8000 | 120 | 76 | 120 | 146 | 165 | 170 | 135 | 125 | 6-Φ9 | Φ15×10 | BT40 taper hole | 5.5 | 3×7011C/P4 2×7009C/P4 | Belt driven type and broaching tool |
| AP3050-01 | 1000 | 250 | 129 | 270 | 305 | 340 | 540 | 155 | 368 | 12-Φ13 | Φ18×12 | IS050 taper hole | - | 318216/226 318214 | Belt driven type and broaching tool |
| AP1540-08G | 8000 | 150 | 84 | 155 | 180 | 202 | 192 | 138 | 181 | 8-Φ11 | Φ17×11 | BT40 taper hole | 7.5 | 2×7014CTDB/P4 2×7012CTDB/P4 | Belt driven type and broaching tool |
| AP1240-08G | 8000 | 120 | 78 | 130 | 146 | 165 | 165 | 128 | 135 | 6-Φ9 | Φ14×8 | BT40 taper hole | 5.5 | 2×7012C/P4 2×7010C/P4 | Belt driven type and broaching tool |

Contact Us:

Anyang General International Co.,Ltd

Add: Suite A, 4/F Jinhao Business Bld., Renmin Rd., Anyang, Henan, P.R.C.

Zip Code: 455000

Tel: (86) 372 5965148

Fax: (86) 372 5951936

[Http://www.gcmachines.com](http://www.gcmachines.com)

E-mail: info@agico.com.cn